

**NEW GOLD RAINY RIVER MINE
APPENDIX F
WEEKLY SPILL, EXCEEDANCE AND
COMPLAINTS REPORT TO FIRST
NATIONS AND COMMUNITIES**



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period February 28th - March 6th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Exceedance	New Gold	Open Pit	3/5/2022	Overpressure Blast Exceedance	Noise	2.7 dB(L)	<p>New Gold detected an overpressure exceedance of 2.7 dB(L) over the peak limit of 128.0 dB(L) during a scheduled blast in the Open Pit.</p> <p>An investigation was initiated that revealed a number of things that contributed to this exceedance. 1- The blast was known as a frost shot, this term is used when frost has been driven into previously blasted material to the point that it cannot be handled and loaded. The holes for a frost shot are much shallower than a typical production shot. 2- The blast was at a higher elevation than any blast prior, except for the original ramp that dropped into the pit below the original Laydown 7 lookout. 3- The sky was overcast on Saturday March 5th , which amplified the effect of the sound of the blast. 4- The timing in a frost shot needs to be quite a bit faster than a production shot which also increase the vibration/sound of a blast. 5- There was a northerly wind the day of the blast which explains why the southern most instrument detected higher levels whereas the other 3 instruments did not read levels over the peak limit of 128.0 dB(L)</p>	<p>Frost shots at this elevation are a very rare occurrence and are not likely to occur again in the near future. Should the need arise to do another frost shot, a smaller blast with a longer delay will be planned and communities will be notified. If possible, the blast will be delayed if there are overcast conditions at the time.</p>	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period April 11th - April 17th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Exceedance	New Gold	West Creek and Marr Diversion	4/11/2022	Turbidity	Land	45 NTU	<p>Rainy River Mine Environmental Technician and Monitor observed turbid water mobilizing through Marr Diversion culverts. The Regulatory Limit for turbidity is 30 NTU and a turbidity reading of 45.0 NTU was obtained. A total suspended solids (TSS) sample was collected as well.</p>	<p>Rapid snow melt from the open field directly north of the TMA seepage collection sump contributed to the influx of water experienced during the duration of the incident. As a TMA seepage collection sump was recently rebuilt last year, it is expected to be limited contaminants contained in it other than total suspended solids.</p> <ol style="list-style-type: none"> 1. Erosion and sediment control measures will be upgraded around the newly constructed sump to include a combination of coir logs, erosion blanket, and seeding. 2. A hardline pipe will be installed from the TMA seepage collection sump over the TMA South Dam and will discharge directly into Cell 3. 3. An electric pump will be installed in the TMA seepage collection sump with a float switch that will pump excess water into Cell 3 with the hardline pipe. This pump will be sized accordingly to deal with the excess water experienced during this incident. High-Volume pump used during the incident will remain in place until second electric pump is installed. 4. New Engineer-of-Record will review TMA South Dam seepage collection system as-builts and provide recommendations if necessary. <p>Total suspended solids results were received for both the single total suspended solids sample collected and the full discharge sample kit sampled from the Marr Diversion and West Creek confluence. They were 21.0 mg/L and 38.0 mg/L, respectively. Additional total suspended solids samples were collected at 08:20 on April 12, 2022 at Marr Diversion and West Creek Diversion confluence and SW26 and were analyzed to be 5.0 mg/l and 6.0 mg/L, respectively.</p> <p>Limited plume migration was observed downstream of the Marr Diversion and West Creek Diversion confluence at the time of the incident and no environmental effects have been observed downstream to date.</p>	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period April 18th - April 24th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Mill	4/21/2022	Lime	Land	Less than 25L	Lime return line had a hole and lime was spraying onto the mill cladding with some of it seeping through a join in the cladding.	The spill was contained with a berm. It was cleaned up and reclaimed back into the milling circuit.	No
Spill	New Gold	South Pond	4/23/2022	Runoff Water	Land	Greater than 100L	As of April 23, 2022, a water spill was identified in South Pond, triggered by a rainfall event (approximately 75mm in 48 hours). The spill started around 11:00 am and stopped around 10:00 pm. The spill flow was estimated in the orders of hundreds of liters per second up to 2:00 pm, after that time the spill flow significantly dropped until it finally stopped around 10:00 pm.	The water level at 12:00 pm was recorded at 363.00 masl compared to the NOWL of 362.80 masl, during this event all water pumped to South Pond was stopped. As of April 26, 2022, the water level at South Pond has gone down to 362.59 masl. All spillage reported back to the open pit.	Yes
Spill	New Gold	North Dam Seepage Collection Sump and Emergency Dump Pond	4/24/2022	Runoff Water	Land	Greater than 100L	On April 24, 2022, North Dam Seepage Collection Sump #5 and Emergency Dump Pond #3 triggered their respective spillways. This was due to recent rainfall event runoff beginning to report to the ponds from the surrounding environment.	For North Dam Seepage Collection Sump #5, on April 23, 2022, the level was over a foot below the spillway and the electric pump that was installed per design was unable to keep up. A 6" diesel pump was also mobilized to assist in pumping. At 10:30 am April 24, 2022, the sump was observed flowing through the spillway so an 8" diesel pump was also mobilized. The water stopped flowing through the spillway on May 3, 2022. For Emergency Dump Pond #3, on April 23, 2022, the pump was started when it was observed that the water level was rising quickly and encroaching on the spillway. On April 23, 2022, the spillway activated but ceased flow by 12 pm on April 24, 2022.	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period April 25th - May 1st, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Exceedance	New Gold	Water Discharge Pond (WDP) and Sediment Pond # 1	4/25/2022	Normal Operating Water Level (NOWL) Exceedance	N/A	N/A	As of April 25, 2022, the water level at WDP and Sediment Pond # 1 had exceeded the respective NOWLs. The WDP water level was measured at 354.06 masl compared to the NOWL of 354.00 masl, and Sediment Pond 1 water level was measured at 352.83 masl compared to the NOWL of 352.70 masl.	In order to bring the water level below the NOWL, a pump was installed at the WDP to pump water from the WDP into the TMA at 380 m ³ /h. Through a different line, a pump was installed at Sediment Pond 1 and water is transferred to the TMA at a rate of 330 m ³ /h. As of April 26, 2022, the water level at WDP has gone down to 354.05 masl, and at Sediment Pond 1 the level has go down to 352.77 masl.	Yes
Exceedance	New Gold	Mine Rock Pond (MRP)	4/28/2022	Normal Operating Water Level (NOWL) Exceedance	N/A	N/A	As of April 28, 2022, the water level at MRP had exceeded the respective NOWLs. The MRP water level was measured at 356.814 masl compared to the NOWL of 356.8 masl.	The water level was brought below the NOWL (measured at 356.776 masl) on April 29, 2022, by continued pumping through the 16 inch South ring main line at an approximate rate 600 m ³ /hr as well as ceasing all pumping inputs into the pond. This pond will continue to be managed this way to maintain water runoff capacities from East Mine Rock Stockpile through the current wet conditions.	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period May 2nd - May 8th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Exceedance	New Gold	Mine Rock Pond (MRP) and Sediment Pond # 1	5/2/2022	Normal Operating Water Level (NOWL) Exceedance	N/A	N/A	As of May 2, 2022, the water level at MRP and Sediment Pond 1 has exceeded the respective NOWLs. The MRP water level was measured at 356.902 masl compared to the NOWL of 356.80 masl and Sediment Pond 1 was measured at 352.767 masl compared to the NOWL 352.70 masl.	As of May 3, 2022, the water level at Sediment Pond 1 decreased to 352.754 masl by pumping water to the TMA at a rate of 330 m ³ /h. In the case of MRP, the water level raised to 356.954 masl, even though the water is being pumped through the 16-inch South ring main line at an approximate rate 500 m ³ /h as well as ceasing all pumping inputs into the pond. New strategies are under consideration to reduce water level and maintain water runoff capacities from East Mine Rock Stockpile through the current wet conditions.	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period May 9th - May 15th, 2022**

Spill Report or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Warehouse	5/13/2022	Oil	Land	10 L	While loading a skid onto a delivery truck, the forks were protruding out the other side of skid and punctured small holes into a drum of oil already loaded onto the truck.	Spill was contained and cleaned up.	No
Spill	New Gold	South Pond and Sediment Pond # 1	5/13/2022	Runoff Water	Land	>100 L	<p>On May 13, 2022, the spillway was activated in South Pond. The spill started around 1:45 pm and stopped around 7:00 pm. The spill flow was estimated in the orders of tens of liters per second up to 6:00 pm, after that time the spill flow significantly dropped until it finally stopped around 7:00 pm. The water level at 12:00 pm was recorded at 362.896 masl compared to the NOWL of 362.80 masl.</p> <p>On May 13, 2022, the water level at Sediment Pond 1 has exceeded the respective NOWLs. The Sediment Pond 1 water level was measured at 352.728 masl compared to the NOWL of 352.70 masl.</p>	<p>During the South Pond event, an extra line was installed to increase the water pumped from South Pond to the mill. Also, the water flow coming from the Open Pit to South Pond was significantly reduced. As of May 24, 2022, the water level at South Pond has gone down to 361.781 masl.</p> <p>In order to bring the water level below the NOWL at Sediment Pond # 1, a pump was installed and water was transferred to the TMA at a rate of 330 m³/h. As of May 24, 2022, the water level at Sediment Pond 1 has gone down to 352.571 masl with plans to start sending this water to Sediment Pond 2 for discharge to the environment.</p>	Yes



New Gold Rainy River Mine Weekly Exceedance, Complaint and Spill Report for Period May 30th - June 5th, 2022

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	South Haul Ramp	6/4/2022	Diesel	Land	600 L	Punctured fuel tank on boulder while pulling out of shovel pit.	Road scraped with grader and dozer, contaminated material disposed of properly.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period June 6th - June 12th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	South Dam	6/6/2022	Oil	Land	0.3 L	During a work area inspection by the Contractor, it was noticed that there was a stain on the ground around their South dam work area.	Material was cleaned up and placed in containment for removal. Reviewed with crews the importance of pre-op and periodic vehicle checks and to report any signs of leaks to the Supervisor immediately.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period June 13th - June 19th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	TMA - Haul Road	6/13/2022	Anti-freeze	Land	9 L	Haul Truck blew an anti-freeze hose.	Operator and Supervisor immediately used spill kits on the spill. All contaminated material was removed and placed in proper container.	No
Spill	New Gold	TMA - South side of Water Treatment Train	6/18/2022	Diesel	Land	25 L	Truck was pulling forward while putting box down, looking back in their mirrors and drove into light plant resulting in damage to the light plant and the light plant fuel tank.	Truck backed away from light plant and additional spill tray placed under it. Remaining diesel fuel in light plant was pumped into a slip tank in back of a light vehicle. Support equipment arrived and telehandler lifted light plant and removed it from the spill location. Material was excavated and removed with proper procedure. Clean material was placed.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period June 20th - June 26th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	TMA - Water Management Pond	6/24/2022	Engine Oil	Land	25 L	Operator of fuel truck was attempting to turn on two-way radio while approaching a corner. Fuel truck entered the ditch and rolled over. Truck was leaking engine oil.	Contaminated soil was cleaned up and disposed of properly.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period July 4th - July 10th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Exceedance	New Gold	Effluent Discharge Location # 1 (EDL1)	7/4/2022	Treated Water	N/A	5707 m ³	Exceeded daily approved discharge. Approved Daily Limit : 13,332 m ³ /day. Actual Daily Limit: 19,039 m ³ /day.	On July 4, 2022, Environment EIT sent out River Flow email to all discharging departments. No email was received confirming receipt of email and confirmation that flow had been changed. On July 5, 2022, Environment EIT logged into PARCView to calculate discharge volume for the next 24 hours and observed, in PARCView, that quantity discharged exceeded permitted amount July 4, 2022. Email was sent to River Flow distribution list to cease discharge for the next 24 hours from all points as overage is carried into the next 24 hours discharge calculation. Update flow SOP to include 30 minute requirement for confirmation email from Operation departments and read receipts.	Yes
Spill	New Gold	Scale Pad	7/5/2022	Hydraulic Fluid	Land	100 L	Hydraulic oil was coming from a blown hydraulic line on a haul truck.	Oil was spilling onto the ground and the truck was shutdown. Contaminated material was disposed of properly.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period July 11th - July 17th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Pit	7/12/2022	Hydraulic Fluid	Land	700 L	Broken hydraulic hose clamp on shovel.	Contained spill with a dozer. Vacuumed up 400 L and taken to waste oil tank at Truck Shop. Remainder drained to floor sumps.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period July 18th - July 24th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Administrative Building Parking Lot	2022-07-22	Brake Fluid	Land	Less than 1 L	Employee found brake fluid spill in West Admin Parking Lot.	Employee started soaking up the spill with spill pads from LV spill kit. Contacted Environment Department who cleaned up and disposed of contaminated material.	No
Spill	New Gold	TMA	2022-07-22	Coolant	Land	Less than 1 L	Employee spotted coolant spill on south dam access ramp.	Contaminated rock scraped up and disposed of properly.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period July 25th - July 31st, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Plant Site by Biodisk	7/27/2022	Domestic Sewage Wastewater	Land	65 L	1. Lift station #3 pumps were unable to keep up to incoming flow due to solids buildup at base of tank causing reduction in flow. 2. Raw water system floats in the potable water plant were caked with iron causing the pumps to continue operating instead of shutting down.	Level of lift station immediately pumped down. Trash pump was immediately used to manually pumped out lift station 3 and transfer wastewater into BioDisk treatment unit. This was continued through nightshift. Dayshift pulled, inspected and cleared pumps the next morning. Water treatment operator cleaning raw water floats. GFL vacuum truck to remove solids from tank bottom.	No
Spill	New Gold	Effluent Discharge Location # 2 (EDL2)	7/28/2022	Treated Water	Land	3502 m3	EDL2 pump started instead of EDL1 pump.	Once discovered, EDL2 pump was turned off immediately and an internal investigation followed.	Yes
Spill	Contractor	TMA	7/28/2022	Diesel	Land	Less than 1 L	Contractor overfilled fuel truck and spilled fuel through a vent while driving down a steep access ramp.	Scene was frozen with spill and contaminated material cleaned up. Reminded not to overfill truck and to monitor vent position.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period August 1st - August 7th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	BCR2	8/3/2022	Ferric Chloride	Land	165 L	Change in dosing product to BCR2 line caused metal fittings to corrode on line.	Metal fittings were replaced with plastic fittings. Contaminated soil was removed and disposed of properly.	Yes
Exceedance	New Gold	Effluent Discharge Location # 1 (EDL1)	8/6/2022	Treated Water	Land	4353 m ³	When preparing the Daily River Flow discharge calculation, it was observed that EDL1 had exceeded the allowable daily discharge for August 6, 2022 by 4353 m ³ . The approved discharge volume was 13,485 m ³ and the actual volume discharged was 17,383 m ³ .	The investigation discovered that the approved discharge volume had been calculated using the times 7 am to 7 pm as opposed to 9 am to 9 pm. This was realized when the total volume was submitted to calculate the flow for August 7, 2022.	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period August 22nd - August 28th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	North Haul Road	8/25/2022	Brake Fluid	Land	50 L	Hauling rock when front left wheel end seal failed.	Used spill kit to clean brake fluid up. Properly disposed of contaminated rock.	No
Spill	New Gold	Scale Pad near Pit	8/25/2022	Coolant	Land	30 L	Tote of coolant was left at the scale pad after a repair job. Haul truck leaving the scale pad hit the tote with the front right tire causing the coolant to slowly leak out.	Maintenance cleaned the spill with absorbent spill pads. All coolant was clean up. Reminder to crews to clean up area after maintenance is performed.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period August 29th - September 4th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Tailings Pond	8/30/2022	Tailings Slurry	Land	2 m ³	Tailings line leaked at a fused flange located within the TMA.	Closed the tailings line feeding the booster pumps and repaired the line. Three 45T loads of contaminated material were placed back into the tailings pond.	No
Spill	New Gold	TMA	9/1/2022	Hydraulic Oil	Land	Less than 10 L	Hydraulic hose blew on loader.	Spill trays and pads immediately used. Supervisor notified. Contaminated material removed.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period September 5th - September 11th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	North Haul Road	9/7/2022	Anti-freeze	Land	10 L	Rock truck overheated and sprayed anti-freeze on the roadway.	Rock truck taken out of service and pin hole leak repaired. Contaminated material cleaned up and disposed of properly.	No
Spill	New Gold	North Ramp	9/11/2022	Diesel	Land	1100 L	Leak noticed on truck travelling up the ramp.	Sump that could have been impacted was bermed off. Ramp cleaned up and contaminated material disposed of.	No



New Gold Rainy River Mine Weekly Exceedance, Complaint and Spill Report for Period September 12th - September 18th, 2022

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	TMA	9/13/2022	Hydraulic Oil	Land	5 L	Backhoe was packing material when one of the hose fittings on the attachment began to leak.	Replaced hose connections that were leaking and checked all other existing hose connections that had the potential to leak. Reviewed potential leaks with the crews, for pre-use inspections. Spill cleaned up.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period September 19th - September 25th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	BCR2	9/20/2022	Ferric Chloride	Land	Unknown	Sump line for BCR2 reagent containment was pulled out of BCR2 pond causing a spill outside of the designed disposal location. This allowed contaminated rain water from the reagent containment to be pumped on the ground beside the pond instead of directly into the pond.	Shut off sump pump, replaced sump line back into BCR2 pond. Clean up remains ongoing for this event as staining appears to have mobilized down the ditch between the Outflow Basin and BCR2. Options for containing this entire area with a pump back system are being explored and will be implemented once identified.	Yes
Spill	New Gold	Mill	9/23/2022	Lime	Land	100 L	Lime leak out of the north door of the mill and onto the ground.	The lime line blew a hole in the elbow, leaking down the north wall over the overhead door and leaking out of the bottom of the door onto the ground outside of the building. Had a loader berm the area of the leak to minimize the spill in the area. The lime pumps were shut down and drained to stop the leak. When pumps were down the leak was patched by maintenance. After the repair, the contaminated area was cleaned up and disposed of in the contaminated soil container and the area was covered and graded.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period September 26th - October 2nd, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Underground	9/27/2022	Hydraulic Oil	Land	250 mL	Spool dripped hydraulic oil when being removed from Cat Haul Truck. Spill tray was not large enough to contain the leak.	Cleaned up immediately and contaminated gravel disposed of properly.	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period October 3rd - October 9th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Pit	10/7/2022	Hydraulic Oil and Anti-freeze	Land	30 L and 15 L	Due to mechanical failure the compressor oil line blew off and caused a hydraulic oil and anti-freeze leak.	Area cleaned up and gravel disposed of properly.	No
Spill	New Gold	BCR2	10/7/2022	Treated Water	Land	Unknown	The spigot on the line from the outflow basin to the water treatment plant shifted to the side and had a small amount of treated water spill from the saddle.	Environmental discovered the spill while sampling and reported to supervisor. Immediately shutdown the pump at the outflow basin to stop the spill, then drained the line and repaired.	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period October 17th - October 23rd, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	Surface of Underground Area	10/18/2022	Hydraulic Oil	Land	300 mL	Small leak discovered under front differential of Mine Cat.	Contaminated crushed rock removed and disposed of properly.	No



New Gold Rainy River Mine Weekly Exceedance, Complaint and Spill Report for Period October 24th - October 30th, 2022

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Outflow Basin	10/26/2022	Treated Water	Land	100 L	Head pressure on the line spilt at the hugger clamp. The line retracted with the colder weather.	Line repaired immediately.	Yes



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period November 7th - November 13th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Sed Pond 2	11/8/2022	Gasoline	Land	10L	Leak discovered in gas tank of passenger truck	Spill tray placed immediately and Area cleaned up and gravel disposed of properly	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period November 20th - November 27th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	Fire Hall	11/26/2022	Engine Oil	Land	~1L	Oil leak under parked Kobota UTV	Spill tray placed under the unit and spill was shoveled up	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period December 12th - December 18th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	CND Area - Mill	12/18/2022	Tailings waste	Land	200L	While cleaning out the CND containment with the vacuum truck it was noticed that the seal on the dump door was leaking. Operators stopped loading and contacted the supervisor	The area was cleaned up with a loader and grader	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period December 19th - December 25th, 2022**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	Contractor	Korpi Road	12/21/2022	Hydraulic Oil	Land	15L	While mobilizing a loader to site, the John Deere 844K broke a hose and began leaking oil onto korpi road	Loader was parked in the access for the tailings line, spill kits and spill trays were used to absorb and limit the amount of oil spilled. Any contaminated soil was removed and properly disposed of	No



**New Gold Rainy River Mine Weekly Exceedance, Complaint
and Spill Report for Period December 26th, 2022 - January 1st, 2023**

SPILL REPORT or OTHER	New Gold or Contractor	Origin	Date Reported	Product Spilled	Impact	Quantity	Description & Cause	Remediation & Disposal	Externally Reportable
Spill	New Gold	170 Bench Phase	12/31/2022	Diesel Fuel	Land	500L	Loarder was hung up on some rocks on the 170 bench. While being guided off the rock, the fuel hose was damaged and 500L of fuel leaked out	Spill pads and a spill container was placed under the leak to draw remaining fuel from tank.	No